



AVAILABLE AS
CUSTOM/LOGO
MATTING


SYNTHETIC COCO

44 OZ. NON-WOVEN INDOOR/OUTDOOR POLYPROPYLENE MATTING

Lush, natural look and feel of coconut coir fibers without compromise.

The best of two worlds, Synthetic Coco offers the lush, natural look and feel of coconut coir fibers without compromise (or shedding). Created to have the same look and feel as our Natural Coco Matting, this synthetic alternative is just as effective.

- 100 % solution-dyed UV stabilized polypropylene fibers are stain and fade resistant
- Heavy, dense face weight.
- Ideal for long-term usage in even the most heavily-trafficked areas.
- Absorbent surface assists in soaking up water, keeping surrounding floor surfaces dry and safe from slips.
- Best suited for recessed mat wells or wall to wall installations

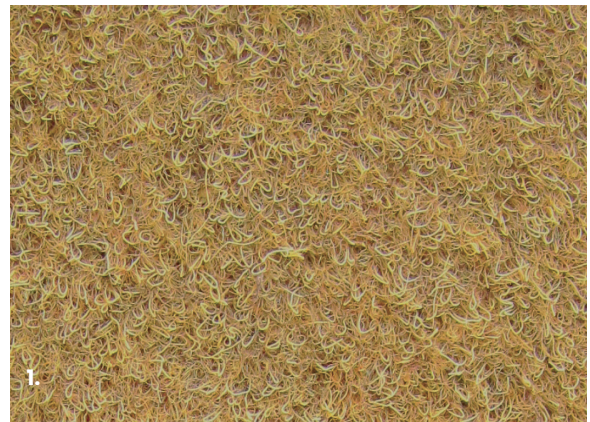

1. Natural SYN011



SOLUTIONS FOR EVERY ENVIRONMENT
1+ 866 284 6287 | www.vangelder-inc.com

SYNTHETIC COCO

44 OZ. NON-WOVEN INDOOR/OUTDOOR POLYPROPYLENE MATTING



SUGGESTED USES

Office Environments, Runners, Conference Rooms, Lobbies, Libraries, Retail/Department Stores, Entryways, etc.

Manufacturing Process:	Non-Woven
Surface Aspect:	Non-Directional Smooth/Velour
Fiber:	100% Solution-dyed UV stabilized polypropylene
Backing:	Safety Track
Pile Height (± 0.5mm):	0.422"
Total Height (± 7.5%):	0.625"
Pile Weight (± 7.5%):	44 oz/sy
Total Weight (± 7.5%):	120 oz/sy
Sheet/Roll Width (± 2%):	12'

LIMITED WARRANTY

Full Commercial Warranty	5 years
Summary of Warranty	

Products must be professionally installed to validate the warranty. van Gelder, Inc. warrants Synthetic Coco Sheet/Roll Goods against wear for a period of 5 years in a commercial application. This warranty applies only to material that is properly installed and maintained, while being used as intended and recommended. If the defect is covered by this warranty and is reported to van Gelder, Inc. within the Warranty period, van Gelder, Inc. will supply new material of same or similar grade to repair or replace the defective material.

- **Wear**
Defined as complete removal of wear layer, pattern and color due to wear from normal traffic and maintenance. If the wear occurs within 5 years from date of purchase, van Gelder, Inc. will provide replacement materials or repair, of only the effected area.
- **Manufacturing Defects**
van Gelder, Inc. warrants Synthetic Coco materials are free from manufacturing defects and will replace defective floor covering and reasonable installation costs for a period of up to one [1] year from date of purchase. van Gelder, Inc. will not pay labor costs to repair or replace materials that defects were apparent before or at the time of installation.
- **Other Limitations**
 - This warranty is non-transferable.
 - Manufacturing defect must be reported within 3 months from date of purchase.
 - This Warranty covers only properly installed & maintained floors.
 - van Gelder, Inc. excluded and will not pay for any consequential or incidental expenses.
 - van Gelder, Inc. reserves the right of final judgment and may refuse claims in certain instances.

*For a copy of the full warranty please ask for a warranty sheet.

PACKAGING & DIMENSIONS

Sheet/Roll Width (± 2%):	12'
--------------------------	-----

TECHNICAL SPECIFICATIONS

Dimensional Stability (ASTM D7570-09):	Pass
Electrostatic Propensity (EN 1815):	>2kV
Electrical Resistivity (IBM / ICL):	Pass, for R.H. ≥40%
Sound Insulation (ISO 10140-1:2010):	≥21dB
Thermal Retention (ISO 11092):	0.15 m K/W Pass

COLOR FASTNESS

To Light (ISO 105 B02):	6
To Water (ISO 105 E01):	5
To Shampoo (ISO 105 C06):	5
To Rubbing (ISO 105 X12):	4 (Dry), 5 (Wet)

FLAMMABILITY RATING

Smoke Density (ASTM E662):	Pass
Surface Flammability (FF 1-70 / ASTM D2859):	Pass

LEED-NC

MR Credit 4 | IEQ Credits 4.1, 4.3, 5

MAINTENANCE

Regular vacuuming (Weekly in low-traffic areas, and daily or twice daily in areas with higher traffic) with a motor-driven brush and beater bar can remove up to 80% of surface dirt, and is the easiest way to prolong the life of your carpet.

Regular vacuuming is key to maintaining your carpet, but eventually the carpet color dulls from dirt and grime stuck in the fibers. The dirt is then carried further into the building to form more soil reservoirs. Additionally, the oil content (15%) of the soil causes particles to stick to carpet fiber and resist vacuuming. To restore the carpet to its best condition, frequent light cleaning gives the best result and is often very cost effective.

*For more information, plus instructions for stain removal, consult vG's Resource Center at www.vangelder-inc.com/resources

IMPORTANT NOTICE

Sample swatches have been cut from an overall design; decoration and shade may vary.

YOUR AUTHORIZED SALES REPRESENTATIVE:

VG_InfoSales_SYNCOCO_62822

van Gelder, Inc.
www.vangelder-inc.com
+1 866 284 6287



EXPERIENCE IT FOR YOURSELF

Talk with your sales representative or request samples at samples@vangelder-inc.com